# Home Report

One triangle, all angles covered RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION

www.shepherd.co.uk





- 1. Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire





## Scottish Single Survey



#### survey report on:

Property address	5 Bridgehouse Court Kilmarnock KA1 4QH
------------------	--

Customer	Peter Murphy

Customer address	5 Bridgehouse Court Kilmarnock KA1 4QH
------------------	--

Prepared by	Shepherd Chartered Surveyors
-------------	------------------------------

Date of inspection	09/04/2024



www.shepherd.co.uk

#### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

Х

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report<sup>2</sup>.

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### **PART 2 - DESCRIPTION OF THE REPORT**

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 <u>Category 1:</u> No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

• There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a mid-terraced converted cottage.	
Accommodation	Ground Floor - Entrance Hall, Living Room, Kitchen and Cloakroom with WC.	
	First Floor - Landing, Two Bedrooms and Shower Room with WC.	
Gross internal floor area (m²)	The gross internal floor area extends to 90 square metres or thereby.	
Neighbourhood and location	The subjects occupy a semi-rural position on the outskirts of the Bellfield and Shortlees areas of Kilmarnock, forming part of a small converted farm development made up of similar properties. The A77 dual carriageway is located in close proximity to the property. Local amenities can be found within a reasonable distance.	
Age	Original construction early to mid 19th century, with the date of conversion works around 1997.	
Weather	Overcast and showery.	
Chimney stacks	N/A	

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The main roof is of pitched design overlaid in slate with metal ridge details. There are dormer projections to the front and rear which are pitched and overlaid in similar materials.
	Our inspection of the roof void was via a first floor ceiling hatch, and our head and shoulders style inspection revealed the roof to be of timber framed construction overlaid in timber sarking. The roof space was noted to be insulated.
Rainwater fittings	Visually inspected with the aid of binoculars where
	appropriate.
	There are PVC gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where
	appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The walls appear to be of solid stone construction, however it may be the case that during conversion works a modern timber frame was constructed. There are rendered external finishes.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are of UPVC framed sealed unit double glazing with similar French doors to the rear. There are timber framed double glazed Velux units at first floor level and external doors are timber double glazed units.

External decorations	Visually inspected.
	Painted joinery and masonry.
Conservatories / porches	N/A
Communal areas	Circulation areas visually inspected.
	External grounds are shared with neighbouring properties and the exact boundary lines should be confirmed.

Garages and permanent outbuildings	N/A
Outside areas and boundaries	Visually inspected.
	There are private garden grounds to the rear overlaid in areas of lawn, stone chips and paving. Boundaries are defined by timber fencing

timber tencing.
There are shared access roads and parking/circulation areas, predominately overlaid in gravel.

Ceilings	Visually inspected from floor level.
	Plasterboard lined.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plasterboard lined.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Flooring is of suspended timber construction throughout. Various fitted floor coverings exist above.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	There are timber panel doors, timber skirtings, timber door surrounds and window sills and a timber tread and riser staircase.
	Kitchen fittings comprise floor and wall mounted units.

Chimney breasts and fireplaces	N/A
Internal decorations	Visually inspected.
	There are paint and tile finishes.

Cellars
---------

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Electricity is from the mains grid with the circuit breaker consumer units and the meter located within a hall cupboard.


Gas	There is no mains gas supply in the area.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Cold water is from the mains supply and where seen, plumber fittings are of copper and PVC pipework. There is a cold water storage tank within the attic.
	The sanitary arrangements comprise a two piece suite within the cloakroom and a three piece suite within the shower room.

Heating and hot water	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
	Space heating is provided by electric panel and storage radiators. Hot water appears to be via an insulated immersion tank located within a landing cupboard.

Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	We understand that drainage is to a shared septic tank located within the common grounds.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon- fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection	An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.
	The property had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. No access was available beneath sanitary or kitchen fittings.
	Windows and external doors were not all fully opened or tested.
	No access was available to any sub-floor areas.
	Full and safe access was not available to the roof void area due to the presence of a thick layer of insulation throughout, storage items, the absence of flooring or crawl boards and the presence of a water tank.

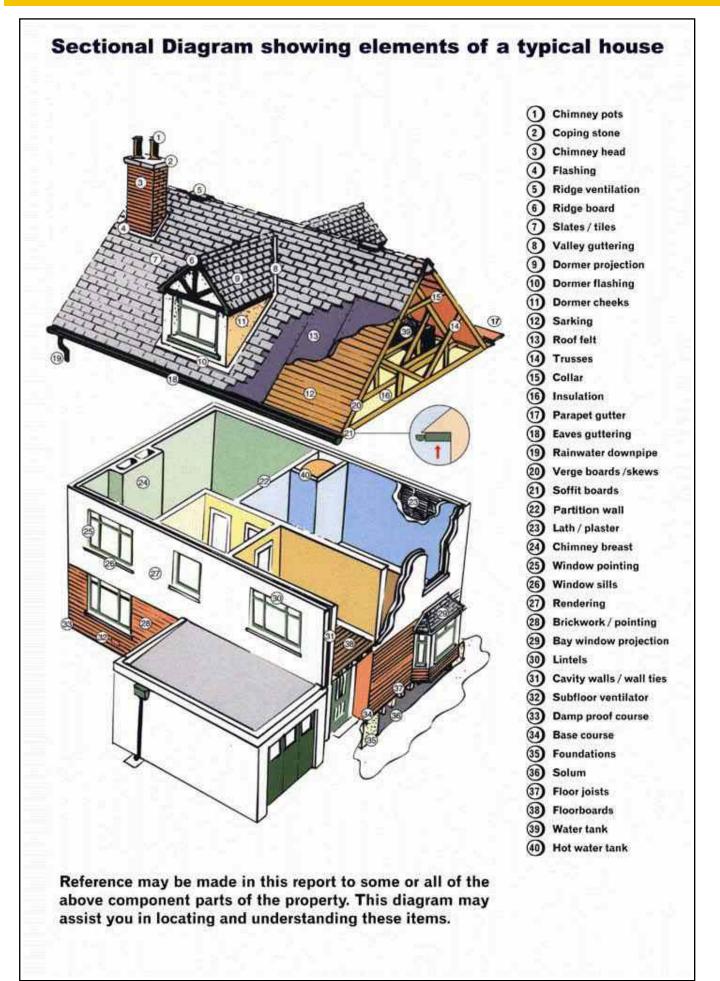

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
• · · ·	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	nt
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range. Damp staining was noted to linings adjacent to window openings at first floor level along with ceiling linings within a ground floor hall cupboard, although when tested with a moisture meter, readings were found to be normal. The original source(s) of dampness should be identified and confirmed as repaired.

Chimney stacks	
Repair category	N/A
Notes	

Roofing including roof space	
Repair category	1
Notes	One or two loose/broken roof slates were noted along with corroded ridge clips however no significant defects were noted at the time of inspection. Roofing contractors recommend that roof coverings are inspected regularly in order to ensure they remain watertight.

Rainwater fittings	
Repair category	1
Notes	Some discoloured PVC goods were noted however within the limitations of our inspection, rainwater goods were seen to be free from significant defect. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy
	rainfall in order to ensure they are free from defect.

Main walls	
Repair category	2
Notes	Localised cracked and bossed render was noted and future repairs may be required. Weep vents have been painted over in places.

Windows, external doors and joinery	
Repair category	2
Notes	Windows and doors were not all fully opened or tested however some items of wear and tear including an air gap at the French doors and evidence of water ingress adjacent to first floor windows were visible. Some double glazed units are defective having failed and allowed condensation to form between the panes. Repairs or replacement of units and/or components may be required. Early evidence of decay was noted to external door surrounds which will deteriorate if left unattended.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	

Communal areas	
Repair category	N/A
Notes	

Garages and permanent outbuildings	
Repair category	N/A
Notes	

Outside areas and boundaries	
Repair category	2
Notes	Boundary fences should be regularly checked and maintained as necessary, with decayed sections of fencing noted. Gravel finishes to shared roads and parking/circulation areas will require upgrading in the short term, and on a regular basis.

Ceilings	
Repair category	1
Notes	Some shrinkage cracking was noted along with visible screw/nail heads however within the limitations of our inspection, no significant defects were noted.

Internal walls	
Repair category	1
Notes	Some shrinkage cracking was noted along with visible screw/nail heads however within the limitations of our inspection, no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition. Isolated loose flooring was detected underfoot.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Internal joinery is generally serviceable however some wear and tear items were noted and fittings are generally of an older style, and future maintenance or upgrading should be anticipated.

Chimney breasts and fireplaces	
Repair category	N/A
Notes	

Internal decorations	
Repair category	2
Notes	The internal decoration will require to be upgraded dependant on individual taste.

Cellars	
Repair category	N/A
Notes	

Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	N/A
Notes	

<b>F</b> Water, plumbing and bathroom fittings	
Repair category	2
Notes	Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight, with evidence of leakage noted below the shower room. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects. A dripping, external overflow pipe was noted to the rear of the property and repairs may be required.

Heating and hot water	
Repair category	1
Notes	Heating is provided by electric panel/storage radiators with an immersion heater for hot water. The system was not tested. It is assumed the system has been installed, serviced and maintained to comply with all regulations. Any service/maintenance records should be sought prior to purchase. Staining was noted adjacent to the hot water cylinder, however this tested dry at the time of inspection.

Drainage	
Repair category	1
Notes	There are understood to be non-mains drainage arrangements in the form of a shared septic tank. The maintenance liability, rights of access and SEPA consents should be confirmed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	N/A
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	N/A
Internal decorations	2
Cellars	N/A
Electricity	1
Gas	N/A
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

#### Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

#### Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The property forms part of a converted farm house with works understood to have been undertaken around 1997. It should be confirmed that all necessary permissions have been obtained.

The exact boundary lines pertaining to the property should be confirmed along with any rights of access and maintenance liabilities for shared roads and parking/circulation areas.

There are understood to be non-mains drainage arrangements in the form of a shared septic tank. The maintenance liability, rights of access for maintenance purposes and availability of SEPA consents should be confirmed.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

#### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £375,000 (THREE HUNDRED AND SEVENTY FIVE THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

#### Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £110,000 (ONE HUNDRED AND TEN THOUSAND POUNDS STERLING).

Signed	Luke Doyle Electronically signed :- 11/04/2024 14:13
Report author	Luke Doyle
Company name	J & E Shepherd Chartered Surveyors

Address	24 Portland Road Kilmarnock KA1 2BS
Date of report	09/04/2024



www.shepherd.co.uk

Property Address	
Address Seller's Name Date of Inspection	5 Bridgehouse Court, Kilmarnock, KA1 4QH Peter Murphy 09/04/2024
Property Details	
Property Type X House Purpose built flat	Bungalow       Purpose built maisonette       Converted maisonette         Converted flat       Tenement flat       Flat over non-residential use         Other (specify in General Remarks)
Property Style Detached Back to back	Semi detached X       Mid terrace       End terrace         High rise block       Low rise block       Other (specify in General Remarks)
Does the surveyor believe that the military, police? Flats/Maisonettes only Floor(s) on whether the surveyor believe that the military survey surveyor believe that the military survey	
Approximate Year of Construction	No. of units in block
Tenure	
X Absolute Ownership	Dther
Accommodation	
Number of Rooms       1       Living room         1       Bathroom(stress)	
Gross Floor Area (excluding garage	es and outbuildings) 90 m² (Internal) 104 m² (External)
Residential Element (greater than 4	0%) X Yes No
Garage / Parking / Outbuildings	
Single garage Double gar	rage Parking space X No garage / garage space / parking space
Available on site?	] No
Permanent outbuildings:	
None.	

Construction
Walls       Brick       X Stone       Concrete       Timber frame       Other (specify in General Remarks)         Roof       Tile       X State       Asphalt       Felt       Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in Yes X No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage Mains X Private None Water X Mains Private None
Electricity       X       Mains       Private       None       Gas       Mains       Private       X       None         Central Heating       X       Yes       Partial       None       None <t< td=""></t<>
Brief description of Central Heating and any non mains services:
Space heating is provided by electric panel/storage radiators. Hot water is provided by an electric immersion tank. None of the system were tested.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way       X Shared drives / access       Garage or other amenities on separate site       X Shared service connections
Ill-defined boundaries       Agricultural land included with property       Other (specify in General Remarks)
Location
X       Residential suburb       Residential within town / city       Mixed residential / commercial       Shared service connections
Commuter village Remote village Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No If Yes provide details in General Remarks.
Roads
Made up road Unmade road Partly completed new road Pedestrian access only Adopted X Unadopted

#### **General Remarks**

The subjects occupy a semi-rural position on the outskirts of the Bellfield and Shortlees areas of Kilmarnock, forming part of a small converted farm development made up of similar properties. The A77 dual carriageway is located in close proximity to the property. Local amenities can be found within a reasonable distance.

At the time of inspection the property was found to be in a condition generally consistent with its age and type of construction but some works of repair and maintenance are required.

The property forms part of a converted farm house with works understood to have been undertaken around 1997. It should be confirmed that all necessary permissions have been obtained.

The exact boundary lines pertaining to the property should be confirmed along with any rights of access and maintenance liabilities for shared roads and parking/circulation areas.

#### **Essential Repairs**

None.		
Estimated cost of essential repairs		]
		]
Retention recommended?	Yes X No	
Retention amount		


#### **Comment on Mortgageability**

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation		
Market value in present condition	£	110,000
Market value on completion of essential repairs	£	
Insurance reinstatement value	£	375,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)		
Is a reinspection necessary?		Yes X No

#### Declaration

Signed	Luke Doyle Electronically signed :- 11/04/2024 14:13
Surveyor's name	Luke Doyle
Professional qualifications	BSc (Hons), MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	24 Portland Road, Kilmarnock, KA1 2BS
Telephone	01563 520318
Email Address	kilmarnock@shepherd.co.uk
Date of Inspection	09/04/2024

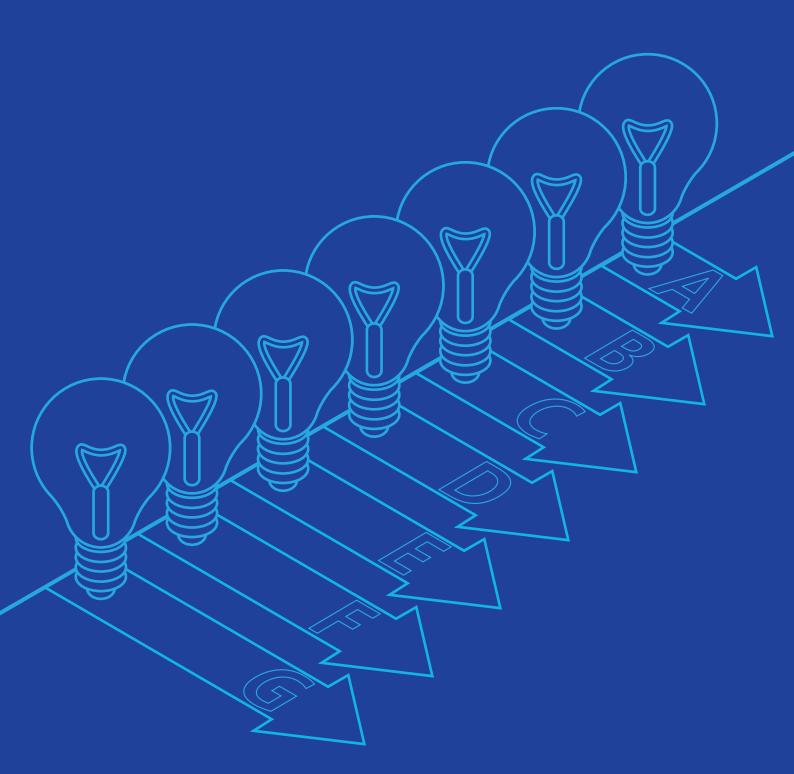

# **Energy Performance Certificate**



#### **Energy Performance Certificate (EPC)**

### Scotland

#### Dwellings

#### 5 BRIDGEHOUSE COURT, TREESWOODHEAD ROAD, SHORTLEES, KILMARNOCK, KA1 4QH

Dwelling type:	Mid-terrace house
Date of assessment:	09 April 2024
Date of certificate:	09 April 2024
Total floor area:	90 m <sup>2</sup>
Primary Energy Indicator:	395 kWh/m²/year

**Reference number:** Type of assessment: Approved Organisation: Main heating and fuel:


4600-8416-0822-1107-1443 RdSAP, existing dwelling Elmhurst Electric storage heaters

#### You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,167	See your recommendations
Over 3 years you could save*	£2,547	report for more information

based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

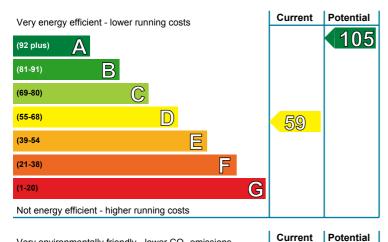

Very environmentally friendly - lower CO<sub>2</sub> emissions

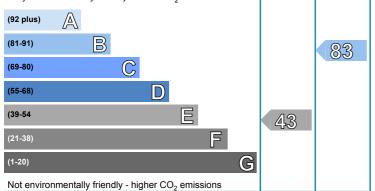

#### Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D** (59). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (43)**. The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£339.00
2 High heat retention storage heaters	£1,200 - £1,800	£1878.00
3 Solar water heating	£4,000 - £6,000	£327.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE **CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE** 

#### 5 BRIDGEHOUSE COURT, TREESWOODHEAD ROAD, SHORTLEES, KILMARNOCK, KA1 4QH 09 April 2024 RRN: 4600-8416-0822-1107-1443 **Recommendations Report**

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Roof room(s), ceiling insulated	<b>★★★</b> ☆	★★★★☆
Floor	Suspended, limited insulation (assumed)	—	_
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Electric storage heaters	★★★☆☆	****
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Room heaters, electric	—	_
Hot water	Electric immersion, off-peak	**	★★☆☆☆
Lighting	Low energy lighting in 89% of fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 67 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### 5 BRIDGEHOUSE COURT, TREESWOODHEAD ROAD, SHORTLEES, KILMARNOCK, KA1 4QH 09 April 2024 RRN: 4600-8416-0822-1107-1443 **Recommendations Report**

Estimated energy costs for this home				
	Current energy costs	Potential energy costs	Potential future savings	
Heating	£4,899 over 3 years	£3,516 over 3 years		
Hot water	£1,794 over 3 years	£630 over 3 years	You could	
Lighting	£474 over 3 years	£474 over 3 years	save £2,547	
Т	over 3 years			

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures			Typical saving	Rating after improvement		
		Indicative cost	per year	Energy	Environment	
1	Floor insulation (suspended floor)	£800 - £1,200	£113	D 61	E 46	
2	High heat retention storage heaters and dual immersion cylinder	£1,200 - £1,800	£626	C 71	E 51	
3	Solar water heating	£4,000 - £6,000	£109	C 73	D 56	
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£580	B 83	D 65	
5	Wind turbine	£15,000 - £25,000	£1250	A 105	B 83	

#### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

#### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### 2 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

#### 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 5 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### 5 BRIDGEHOUSE COURT, TREESWOODHEAD ROAD, SHORTLEES, KILMARNOCK, KA1 4QH 09 April 2024 RRN: 4600-8416-0822-1107-1443 **Recommendations Report**

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	9,106	N/A	N/A	N/A
Water heating (kWh per year)	2,048			

#### About this document

Related party disclosure:

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number:	Mr. Luke Doyle EES/019306
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square
	Dundee
	DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

No related party

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### 5 BRIDGEHOUSE COURT, TREESWOODHEAD ROAD, SHORTLEES, KILMARNOCK, KA1 4QH 09 April 2024 RRN: 4600-8416-0822-1107-1443 **Recommendations Report**


#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





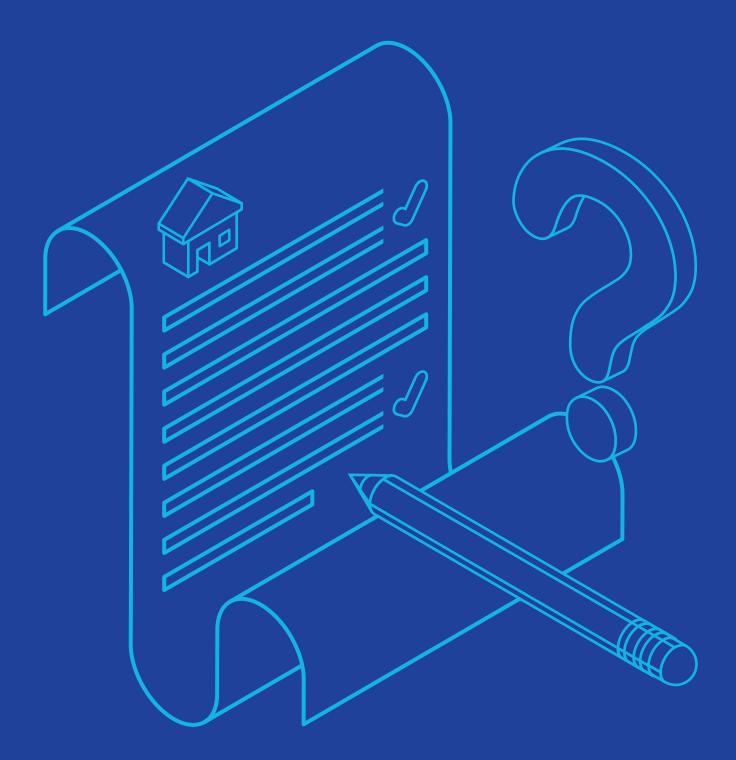



Property address	5 Bridgehouse Court Kilmarnock KA1 4QH
Seller(s)	Peter Murphy
Completion date of property questionnaire	10/04/2024

#### Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property?25 years		25 years
2.	Council tax		
	Which Council Tax band is your proper	ty in?	D
3.	Parking		
	<ul> <li>What are the arrangements for parking (Please tick all that apply) <ul> <li>Garage</li> <li>Allocated parking space</li> <li>Driveway</li> <li>Shared parking</li> <li>On street</li> <li>Resident permit</li> <li>Metered Parking</li> <li>Other (please specify):</li> </ul> </li> </ul>	at your property?	
4.	Conservation area		
	Is your property in a designated Conse special architectural or historical inter- which it is desirable to preserve or enh	est, the character or appeara	

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	No
	(iii) Please describe the changes made to the windows doors, or patio doors approximate dates when the work was completed):	(with
	Please give any guarantees which you received for this work to your solicito agent.	r or estate
	Dont Know	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	

	<ul><li>i) When was your central hea installed?</li></ul>	any system of partia	a contrai neuting system	
	Dont know			
	(ii) Do you have a maintenand	ce contract for the ce	entral heating system?	No
	If you have answered yes, ple you have a maintenance con		ne company with which	
	(iii) When was your maintena (Please provide the month ar		enewed?	
8.	Energy Performance Certifica	ate		
	Does your property have an l than 10 years old?	Energy Performance	Certificate which is less	No
9.	Issues that may have affected your property			
a.	Has there been any storm, flood, fire or other structural damage to the property while you have owned it?			No
	If you have answered yes, is insurance claim?	the damage the subj	ect of any outstanding	
b.	Are you aware of the existen	ce of asbestos in you	ır property?	No
	If you have answered yes, ple	ease give details:		
10.	Services			
a.	Please tick which services ar supplier:	e connected to your	property and give details o	of the
	Services	Connected	Supplier	
	Gas or liquid petroleum gas	No		
	Water mains or private water supply	Yes	Scottish Water	
	Electricity	Yes	Scottish power	
	Mains drainage     Yes     Local Authority			

	Cable TV or satellite	No		
	Broadband	No		
).	Is there a septic tank sys	tem at your property?		Yes
	If you have answered yes	s, please answer the two question	ons below:	
	(i) Do you have appropria tank?	ite consents for the discharge f	rom your septic	Don't know
	(ii) Do you have a mainter	nance contract for your septic	tank?	Yes
	If have answered yes, det maintenance contract:	tails of the company with which	n you have a	
	Dont Know			
11.	Responsibilities for share	ed or common areas		
а.		sponsibility to contribute to tl e repair of a shared drive, priv ea?		Yes
	If you have answered ye	es, please give details:		
	Resident committee			
b.		to contribute to repair and ma or other common areas?	aintenance of the	Yes
	If you have answered ye	<u>es,</u> please give details:		
	as above			
с.	Has there been any major during the time you have	r repair or replacement of any p owned the property?	part of the roof	No
d.		walk over any of your neighb our rubbish bin or to maintair		No
	If you have answered ye	<u>s,</u> please give details:		
е.		do any of your neighbours ha , for example to put out their i es?	•	No
	If you have answered ye	es, please give details:		
f.	your property? (public r	, is there a public right of way ight of way is a way over whic r not the land is privately-own	ch the public has a	No

	If you have answered yes, please give details:	
12.	Charges associated with the property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u> , please provide the name and address, and give details of any deposit held and approximate charges: as above	Yes
b.	Is there a common buildings insurance policy? <u>If you have answered yes</u> , is the cost of the insurance included in monthly/annual factor's charges?	Don't know
с.	Please give details of any other charges you have to pay on a regular ba upkeep of common areas or repair works, for example to a residents' as or maintenance or stair fund.	
10	£60 / month to residents committee	
13.	Specialist work	
а.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u> , please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	Νο
b.	As far as you are aware, has any preventative work for dry rot,wet rot, or damp ever been carried out to your property? <u>If you have answered yes</u> , please give details:	No
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.Guarantees are held by:	
4.4		
14.	Guarantees	

а.	Are there any guarantees or warranties for any of the following?			
	(i) Electrical work	Don't know		
	(ii) Roofing	Don't know		
	(iii) Central heating	Don't know		
	(iv) National House Building Council (NHBC)	Don't know		
	(v) Damp course	Don't know		
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	Don't know		
b.	If you have answered 'yes' or 'with title deeds', please give details of the installations to which the guarantee(s) relate(s):	e work or		
С.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes.</u> please give details:	No		
15.	Boundaries	1		
	So far as you are aware, has any boundary of your property been moved in thelast 10 years?	No		
	If you have answered yes, please give details:			
16.	Notices that affect your property	1		
	In the past three years have you ever received a notice:			
а.	advising that the owner of a neighbouring property has made a planning application?	No		
b.	that affects your property in some other way?	No		
с.	that requires you to do any maintenance, repairs or improvements to your property?	No		
	If you have answered yes to any of a-c above, please give the notices to yo or estate agent, including any notices which arrive at any time before the day of the purchaser of your property.			

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Mr Peter Murphy Date: 10/04/2024



### Residential

#### Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report Energy Performance Certificate (EPC) Private Sale Valuation Inheritance Tax Valuation Capital Gains Tax Valuation Separation Valuation Driveby Valuation **Desktop Valuation** New Build, Development & Plot Valuation Extension & Alteration Valuation Portfolio Valuation **Rental Valuation Expert Witness Report** Council Tax Appeal **Bespoke Condition Report** 

### Commercial

Commercial Valuation Commercial Agency Acquisitions & Disposals Commercial Lease Advisory Rent Reviews Asset Management Project Consultancy Development Appraisals Rating Commercial Property Auctions Property Management Professional Services Licensed Trade / Leisure

### Property & Construction

Quantity Surveying Building Surveying Project Management Dispute Resolution Support Services Principal Designer Clerk of Works Commercial EPC Fire Engineering Health & Safety Management Employer's Agent Energy Department Housing Services Development Monitoring Mediation Services

Aberdeen ▲ △ 01224 202800 Ayr △ 01292 267987 Coatbridge △ 01236 436561 Cumbernauld △ 01236 780000 Dalkeith △ 0131 663 2780 Dumbarton △ 01389 731682



 Dumfries

 ▲ 1387 264333

 Dundee

 ▲ 01382 200454

 ▲ 01382 20054

 ▲ 01382 720699

 Dunfermline

 ▲ 01383 722337

 ▲ 01383 731841

 ▲ 01355 248535

Edinburgh ▲ 0131 2251234 ▲ 0131 557 9300





Elgin ▲ 01343 553939

▲ 01324 635 999

Fraserburgh ▲ 01346 517456

A 01896 750150

▲ ▲ 0141 331 2807

Glasgow South ▲ 0141 649 8020

Galashiels

Glasgow

Falkirk

Glasgow West End ▲ 0141 353 2080 Greenock ▲ 01475 730717 Hamilton ▲ 01698 897548 Inverness ▲ ▲ 01463 712239 Kilmarnock ▲ 01563 520318 Kirkcaldy ▲ 01592 205442 Livingston ▲ 01506 4167777 Montrose ▲ 01674 676678 Motherwell ▲ 01698 252229 Musselburgh ▲ 0131 653 3456 Oban ▲ 0141 889 8334 Perth ▲ 01738 638188 ▲ 01738 638181 Peterhead ▲ 01779 470766 St Andrews ▲ 01334 477773 ▲ 01334 477773 ▲ 01334 477469 Saltcoats ▲ 01786 450438 ▲ 01786 474476

www.shepherd.co.uk
 www.hardies.co.uk